

**Flood Control Project Maintenance
Levee Inspections
LMA District Cover Sheet
Spring 2013 Levee Inspection Results**

Reclamation District No. 0765 Glide

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

* SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0765 Glide

Waterway		Bank	Unit Miles
Unit No. 01 Sacramento River		Right	1.74

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	03/05/2013 - 03/05/2013			
DWR Inspector	Richard Willoughby			
Accompanied By	Everett Lovejoy RD765			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1				Emergency Supplies & Equipment	WS	M Ma		°	°	18
								DWR ID: DWR_RD0765_01_s_2013_18		
2				Operations & Maintenance Manuals	WS	M Ma		°	°	44
								DWR ID: DWR_RD0765_01_s_2012_44		
3				Flood Preparedness & Training	WS	M Ma		°	°	46
								DWR ID: DWR_RD0765_01_s_2012_46		
4	0.00	1.74		Vegetation	WS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	38.502776 ° -121.560009 °	38.480116 ° -121.549436 °	39
								DWR ID: DWR_RD0765_01_s_2013_39		
5	0.00	0.11		Encroachments	LS	M En	FE : Fence	38.502962 ° -121.560112 °	38.501373 ° -121.560402 °	12
								DWR ID: DWR_RD0765_01_s_2012_12		
6	0.05	0.05		Trim / Thin Trees	LS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.502253 ° -121.560192 °	38.502253 ° -121.560192 °	3 Y
								DWR ID: DWR_RD0765_01_s_2012_3		
7	0.09	0.09		Trim / Thin Trees	WSA/W	M Ma	T1 : Trim trees to at least five feet above ground level.	38.501650 ° -121.560290 °	38.501650 ° -121.560290 °	27
								DWR ID: DWR_RD0765_01_s_2012_27		
8	0.12	0.19		Trim / Thin Trees	LS	M Ma	T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.	38.501215 ° -121.560432 °	38.500271 ° -121.560434 °	28 Y
								DWR ID: DWR_RD0765_01_s_2012_28		
9	0.13	1.72		Vegetation	LS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	38.501155 ° -121.560419 °	38.480246 ° -121.549522 °	45
								DWR ID: DWR_RD0765_01_s_2013_45		
10	0.14	0.14		Vegetation	LS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability.	38.500928 ° -121.560431 °	38.500928 ° -121.560431 °	22 Y
								DWR ID: DWR_RD0765_01_s_2012_22		
11	0.19	0.35		Trim / Thin Trees	LS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.500343 ° -121.560507 °	38.498032 ° -121.560337 °	14
								DWR ID: DWR_RD0765_01_s_2012_14		
12	0.19	0.19		Encroachments	LS	C Ma	GA : Garbage	38.500204 ° -121.560496 °	38.500204 ° -121.560496 °	8
								DWR ID: DWR_RD0765_01_f_2012_8		
13	0.21	0.21		Trim / Thin Trees	WSA/W	M Ma	T1 : Trim trees to at least five feet above ground level.	38.500018 ° -121.560457 °	38.500018 ° -121.560457 °	25
								DWR ID: DWR_RD0765_01_s_2012_25		
14	0.24	0.24		Vegetation	LS	M Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild berryvines on landside slope.	38.499530 ° -121.560490 °	38.499530 ° -121.560490 °	49 Y
								DWR ID: DWR_RD0765_01_s_2013_49		

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

LMR No.	Levee Mile		Category	Item	Location * + Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End					Start	End	
15	0.25	0.28		Trim / Thin Trees	WS U Ma	T2 : Thin trees to allow visibility of the ground and room to flood fight.	38.499405 ° -121.560445 °	38.499042 ° -121.560430 °	11 Y
DWR ID: DWR_RD0765_01_s_2012_11									
16	0.31	0.31		Vegetation	LS M Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild berryvines on landside toe.	38.498516 ° -121.560463 °	38.498516 ° -121.560463 °	31 Y
DWR ID: DWR_RD0765_01_f_2012_31									
17	0.32	0.32		Trim / Thin Trees	WS M Ma	T2 : Thin trees to allow visibility of the ground and room to flood fight.	38.498453 ° -121.560360 °	38.498453 ° -121.560360 °	23 Y
DWR ID: DWR_RD0765_01_s_2012_23									
18	0.41	0.41		Trim / Thin Trees	LS M Ma	T1 : Trim trees to at least five feet above ground level.	38.497196 ° -121.560147 °	38.497196 ° -121.560147 °	21 Y
DWR ID: DWR_RD0765_01_s_2012_21									
19	0.41	0.52		Trim / Thin Trees	WS M Ma	T2 : Thin trees to allow visibility of the ground and room to flood fight.	38.497125 ° -121.560087 °	38.495648 ° -121.559391 °	24 Y
DWR ID: DWR_RD0765_01_s_2012_24									
20	0.41	0.41		Vegetation	LS U Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild berryvines on landside toe.	38.497069 ° -121.560106 °	38.497069 ° -121.560106 °	47 Y
DWR ID: DWR_RD0765_01_f_2012_47									
21	0.43	0.47		Trim / Thin Trees	LS M Ma	T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.	38.496792 ° -121.560026 °	38.496321 ° -121.559842 °	32 Y
DWR ID: DWR_RD0765_01_s_2012_32									
22	0.48	0.50		Vegetation	LS U Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: District removed some of the wild growth on landside slope and toe.	38.496217 ° -121.559788 °	38.495855 ° -121.559586 °	33 Y
DWR ID: DWR_RD0765_01_s_2012_33									
23	0.54	0.64		Trim / Thin Trees	LS M Ma	T1 : Trim trees to at least five feet above ground level.	38.495347 ° -121.559291 °	38.494204 ° -121.558313 °	34 Y
DWR ID: DWR_RD0765_01_s_2012_34									
24	0.57	0.60		Trim / Thin Trees	WS M Ma	T1 : Trim trees to at least five feet above ground level.	38.495035 ° -121.559027 °	38.494642 ° -121.558697 °	10 Y
DWR ID: DWR_RD0765_01_s_2012_10									
25	0.63	0.71		Trim / Thin Trees	WS M Ma	T1 : Trim trees to at least five feet above ground level.	38.494171 ° -121.558253 °	38.493392 ° -121.557640 °	15 Y
DWR ID: DWR_RD0765_01_s_2012_15									
26	0.69	0.73		Trim / Thin Trees	LS M Ma	T1 : Trim trees to at least five feet above ground level.	38.493596 ° -121.557832 °	38.493077 ° -121.557451 °	35 Y
DWR ID: DWR_RD0765_01_s_2012_35									
27	0.76	0.80		Vegetation	LS M Ma	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.492713 ° -121.557224 °	38.492176 ° -121.556893 °	50 Y
DWR ID: DWR_RD0765_01_s_2013_50									
28	0.78	0.81		Trim / Thin Trees	LS M Ma	T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.	38.492392 ° -121.557026 °	38.492034 ° -121.556820 °	36 Y
DWR ID: DWR_RD0765_01_s_2012_36									

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	+ Issue Type N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
29	0.87	0.99		Trim / Thin Trees	LS	U Ma	T1 : Trim trees to at least five feet above ground level.	38.491283 ° -121.556360 °	38.489771 ° -121.555451 °	17 Y
DWR ID: DWR_RD0765_01_s_2012_17										
30	0.97	0.97		Vegetation	LS	U Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berryvines on landside slope.	38.489962 ° -121.555573 °	38.489962 ° -121.555573 °	81 Y
DWR ID: DWR_RD0765_01_s_2012_81										
31	0.99	0.99		Encroachments	LS	M En	DT : Ditch Inspector Comments: Ditch has been in place for several years.	38.489653 ° -121.555399 °	38.489653 ° -121.555399 °	51 Y
DWR ID: DWR_RD0765_01_s_2013_51										
32	0.99	1.15		Trim / Thin Trees	WS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.489664 ° -121.555370 °	38.487617 ° -121.554200 °	6 Y
DWR ID: DWR_RD0765_01_f_2012_6										
33	1.02	1.02		Vegetation	LS	U Ma	V7 : Trees / Woody Vegetation Inspector Comments: Fig trees on landside slope	38.489283 ° -121.555223 °	38.489283 ° -121.555223 °	40 Y
DWR ID: DWR_RD0765_01_s_2012_40										
34	1.04	1.04		Vegetation	LS	M En	V6 : Landscaping Inspector Comments: Cactus at landside toe.	38.489036 ° -121.555054 °	38.489036 ° -121.555054 °	16 Y
DWR ID: DWR_RD0765_01_f_2012_16										
35	1.08	1.08		Trim / Thin Trees	LS	U Ma	T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.	38.488503 ° -121.554757 °	38.488503 ° -121.554757 °	37 Y
DWR ID: DWR_RD0765_01_s_2012_37										
36	1.10	1.16		Trim / Thin Trees	LS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.488279 ° -121.554615 °	38.487465 ° -121.554117 °	38 Y
DWR ID: DWR_RD0765_01_s_2012_38										
37	1.15	1.15		Vegetation	LS	U Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild berryvines at landside toe.	38.487645 ° -121.554233 °	38.487645 ° -121.554233 °	48 Y
DWR ID: DWR_RD0765_01_f_2012_48										
38	1.16	1.16		Trim / Thin Trees	WS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.487473 ° -121.554080 °	38.487473 ° -121.554080 °	9 Y
DWR ID: DWR_RD0765_01_s_2012_9										
39	1.19	1.22		Encroachments	LS	M En	BU : Building	38.487127 ° -121.553910 °	38.486702 ° -121.553652 °	43 Y
DWR ID: DWR_RD0765_01_s_2012_43										
40	1.32	1.35		Trim / Thin Trees	LS	M Ma	T1 : Trim trees to at least five feet above ground level.	38.485280 ° -121.552860 °	38.485002 ° -121.552687 °	26 Y
DWR ID: DWR_RD0765_01_s_2012_26										
41	1.33	1.33		Encroachments	WS	M En	TR : Tree or limb Inspector Comments: Downed tree on waterside slope.	38.485245 ° -121.552807 °	38.485245 ° -121.552807 °	20 Y
DWR ID: DWR_RD0765_01_s_2012_20										
42	1.36	1.36		Vegetation	WS	U Ma	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.484877 ° -121.552540 °	38.484877 ° -121.552540 °	7 Y
DWR ID: DWR_RD0765_01_s_2012_7										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

LMR No.	Levee Mile		Category	Item	Location * + Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End					Start	End	
43	1.41	1.41	Trim / Thin Trees	WS Ma	M	T1 : Trim trees to at least five feet above ground level.	38.484316 ° -121.552115 °	38.484316 ° -121.552115 °	4 Y
DWR ID: DWR_RD0765_01_s_2012_4									
44	1.44	1.47	Trim / Thin Trees	WS Ma	U	T2 : Thin trees to allow visibility of the ground and room to flood fight.	38.483925 ° -121.551845 °	38.483530 ° -121.551587 °	5 Y
DWR ID: DWR_RD0765_01_s_2012_5									
45	1.46	1.46	Trim / Thin Trees	LS Ma	M	T1 : Trim trees to at least five feet above ground level.	38.483640 ° -121.551727 °	38.483640 ° -121.551727 °	41 Y
DWR ID: DWR_RD0765_01_s_2012_41									
46	1.50	1.51	Trim / Thin Trees	LS Ma	M	T1 : Trim trees to at least five feet above ground level.	38.483170 ° -121.551367 °	38.482965 ° -121.551265 °	42 Y
DWR ID: DWR_RD0765_01_s_2012_42									
47	1.52	1.73	Vegetation	WS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.482893 ° -121.551121 °	38.480257 ° -121.549458 °	1 Y
DWR ID: DWR_RD0765_01_s_2012_1									
48	1.54	1.63	Vegetation	LS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.482590 ° -121.551020 °	38.481420 ° -121.550262 °	29 Y
DWR ID: DWR_RD0765_01_s_2012_29									
49	1.54	1.54	Encroachments	WSA/W En	GA	GA : Garbage	38.482610 ° -121.550937 °	38.482610 ° -121.550937 °	2 Y
DWR ID: DWR_RD0765_01_f_2012_2									
50	1.67	1.67	Trim / Thin Trees	WS Ma	M	T1 : Trim trees to at least five feet above ground level.	° -121.549654 °	38.480892 ° -121.549654 °	53 Y
DWR ID: DWR_RD0765_01_s_2013_53									
51	1.69	1.69	Encroachments	WSA/W En	GA	GA : Garbage Inspector Comments: District removed trash.	38.480770 ° -121.549514 °	38.480895 ° -121.549556 °	30 Y
DWR ID: DWR_RD0765_01_s_2012_30									
52	1.69	1.70	Encroachments	WSA/W Ma	PR	PR : Prunings Inspector Comments: Landowner burned pruning pile.	38.480763 ° -121.549581 °	38.480632 ° -121.549543 °	13 Y
DWR ID: DWR_RD0765_01_s_2012_13									
53	1.71	1.72	Trim / Thin Trees	WS Ma	U	T1 : Trim trees to at least five feet above ground level.	38.480519 ° -121.549513 °	38.480164 ° -121.549445 °	52 Y
DWR ID: DWR_RD0765_01_s_2013_52									

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	6
Start Levee Mile	0.05
End Levee Mile	0.05
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking north (upstream) at trees on landside slope.	
richard_s_20130307_976.JPG	



Levee Mile Report Line	8
Start Levee Mile	0.12
End Levee Mile	0.19
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking west at trees on landside toe.	
richard_s_20130304_718.jpg	



Levee Mile Report Line	8
Start Levee Mile	0.12
End Levee Mile	0.19
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking downstream (south) at trees on landside slope & toe.	
richard_s_20130304_719.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	10
Start Levee Mile	0.14
End Levee Mile	0.14
Location	Land Side
Category	
Item	Vegetation
Looking northwest at dense vegetation on landside slope.	
richard_s_20130307_977.JPG	



Levee Mile Report Line	14
Start Levee Mile	0.24
End Levee Mile	0.24
Location	Land Side
Category	
Item	Vegetation
Looking at wild berryvines or wild roses on landside slope and toe.	
richard_s_20130307_978.JPG	



Levee Mile Report Line	15
Start Levee Mile	0.25
End Levee Mile	0.28
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking northeast at overgrown trees on waterside slope.	
richard_s_20130304_708.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	15
Start Levee Mile	0.25
End Levee Mile	0.28
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking north at dense trees on waterside slope from fall 2010 inspection.	
richard_s_20130304_709.jpg	



Levee Mile Report Line	15
Start Levee Mile	0.25
End Levee Mile	0.28
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking upstream (north) at dense vegetation and trees from 2011 spring inspection.	
richard_s_20130304_710.jpg	



Levee Mile Report Line	15
Start Levee Mile	0.25
End Levee Mile	0.28
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking north (upstream) at dense trees on landside slope and shoulder. (Spring 2013)	
richard_s_20130307_984.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	15
Start Levee Mile	0.25
End Levee Mile	0.28
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking south (downstream) at dense trees on landside slope and shoulder. (Spring 2013)	
richard_s_20130307_985.JPG	



Levee Mile Report Line	17
Start Levee Mile	0.32
End Levee Mile	0.32
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking north (upstream) at untrimmed trees on waterside shoulder and slope.	
richard_s_20130307_983.JPG	



Levee Mile Report Line	20
Start Levee Mile	0.41
End Levee Mile	0.41
Location	Land Side
Category	
Item	Vegetation
Looking west at dense berryvines on landside toe.	
richard_s_20130304_736.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	21
Start Levee Mile	0.43
End Levee Mile	0.47
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking southwest at dense vegetation on landside slope and toe.	
richard_s_20130304_725.jpg	



Levee Mile Report Line	22
Start Levee Mile	0.48
End Levee Mile	0.50
Location	Land Side
Category	
Item	Vegetation
Looking northwest at trees on landside toe from 2010 fall inspection.	
richard_s_20130304_726.jpg	



Levee Mile Report Line	22
Start Levee Mile	0.48
End Levee Mile	0.50
Location	Land Side
Category	
Item	Vegetation
Looking downstream (south) at trees on landside slope & toe.	
richard_s_20130304_727.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	22
Start Levee Mile	0.48
End Levee Mile	0.50
Location	Land Side
Category	
Item	Vegetation
Looking downstream (southwest) at dense vegetation on landside slope.	
richard_s_20130304_728.jpg	



Levee Mile Report Line	22
Start Levee Mile	0.48
End Levee Mile	0.50
Location	Land Side
Category	
Item	Vegetation
Looking upstream (northwest) at dense vegetation on landside slope.	
richard_s_20130304_729.jpg	



Levee Mile Report Line	22
Start Levee Mile	0.48
End Levee Mile	0.50
Location	Land Side
Category	
Item	Vegetation
Looking southwest at dense vegetation on landside slope and toe.	
richard_s_20130307_979.JPG	



<p>* Location</p> <p>LS : Land Side WS : Water Side CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p> <p>N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain</p>	<p>+ Issue Type</p> <p>Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement</p>
---	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013


Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	27
Start Levee Mile	0.76
End Levee Mile	0.80
Location	Land Side
Category	
Item	Vegetation
Looking northwest at vegetation on landside slope.	
richard_s_20130307_980.JPG	



Levee Mile Report Line	29
Start Levee Mile	0.87
End Levee Mile	0.99
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking downstream (south) at dense trees on landside slope and toe.	
richard_s_20130304_713.jpg	

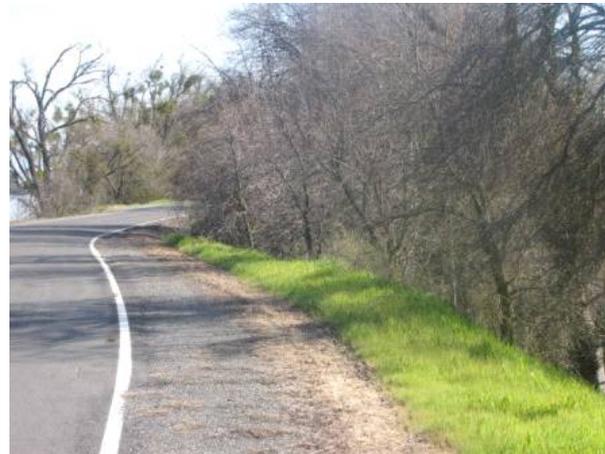

Levee Mile Report Line	29
Start Levee Mile	0.87
End Levee Mile	0.99
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking upstream (north) at dense trees on landside slope and toe.	
richard_s_20130304_714.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	29
Start Levee Mile	0.87
End Levee Mile	0.99
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking south at dense trees on landside shoulder and slope. (November 2011)	
richard_s_20130304_715.jpg	



Levee Mile Report Line	29
Start Levee Mile	0.87
End Levee Mile	0.99
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking southwest at dense trees on landside slope and toe spring 2012.	
richard_s_20130304_716.jpg	



Levee Mile Report Line	30
Start Levee Mile	0.97
End Levee Mile	0.97
Location	Land Side
Category	
Item	Vegetation
Looking west at dense berryvines and wildroses on landside shoulder and slope. (November 2011)	
richard_s_20130304_738.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	30
Start Levee Mile	0.97
End Levee Mile	0.97
Location	Land Side
Category	
Item	Vegetation
Looking northwest at vines on landside toe spring 2012.	
richard_s_20130304_739.jpg	



Levee Mile Report Line	31
Start Levee Mile	0.99
End Levee Mile	0.99
Location	Land Side
Category	
Item	Encroachments
Looking west at irrigation ditch at landside toe.	
richard_s_20130307_981.JPG	



Levee Mile Report Line	33
Start Levee Mile	1.02
End Levee Mile	1.02
Location	Land Side
Category	
Item	Vegetation
Looking southwest at fig trees and other trees on landside slope and toe.	
richard_s_20130304_734.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	34
Start Levee Mile	1.04
End Levee Mile	1.04
Location	Land Side
Category	
Item	Vegetation
Looking west at cactus at landside toe.	
richard_s_20130304_712.JPG	



Levee Mile Report Line	35
Start Levee Mile	1.08
End Levee Mile	1.08
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking downstream (south) at trees on landside slope & toe from 2010 fall inspection.	
richard_s_20130304_730.jpg	



Levee Mile Report Line	35
Start Levee Mile	1.08
End Levee Mile	1.08
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking west at trees on landside slope & toe.	
richard_s_20130304_731.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	35
Start Levee Mile	1.08
End Levee Mile	1.08
Location	Land Side
Category	
Item	Trim / Thin Trees
Looking downstream (southwest) at dense trees on landside slope and toe.	
richard_s_20130304_732.jpg	



Levee Mile Report Line	37
Start Levee Mile	1.15
End Levee Mile	1.15
Location	Land Side
Category	
Item	Vegetation
Looking southwest at dense vegetation on landside slope and toe.	
richard_s_20130304_737.JPG	



Levee Mile Report Line	39
Start Levee Mile	1.19
End Levee Mile	1.22
Location	Land Side
Category	
Item	Encroachments
Looking northwest at buildings along landside toe.	
richard_s_20130304_735.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	41
Start Levee Mile	1.33
End Levee Mile	1.33
Location	Water Side
Category	
Item	Encroachments
Looking northeast at tree limbs on waterside slope.	
richard_s_20130304_717.jpg	



Levee Mile Report Line	42
Start Levee Mile	1.36
End Levee Mile	1.36
Location	Water Side
Category	
Item	Vegetation
Looking upstream (north) at dense vegetation on waterside slope.	
richard_s_20130304_705.jpg	



Levee Mile Report Line	42
Start Levee Mile	1.36
End Levee Mile	1.36
Location	Water Side
Category	
Item	Vegetation
Looking southeast at dense vegetation on waterside slope. (Fall Inspection 2012)	
richard_s_20130304_706.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	44
Start Levee Mile	1.44
End Levee Mile	1.47
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking upstream (north) at dense trees on waterside slope.	
richard_s_20130304_703.jpg	



Levee Mile Report Line	44
Start Levee Mile	1.44
End Levee Mile	1.47
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking north at dense vegetation on waterside slope. (Fall Inspection 2012)	
richard_s_20130304_704.JPG	



Levee Mile Report Line	47
Start Levee Mile	1.52
End Levee Mile	1.73
Location	Water Side
Category	
Item	Vegetation
Looking south at dense trees and vegetation on waterside slope. (November 2011)	
richard_s_20130304_699.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	47
Start Levee Mile	1.52
End Levee Mile	1.73
Location	Water Side
Category	
Item	Vegetation
Looking north at dense vegetation on waterside slope.	
richard_s_20130304_700.JPG	



Levee Mile Report Line	47
Start Levee Mile	1.52
End Levee Mile	1.73
Location	Water Side
Category	
Item	Vegetation
Looking northeast at dense vegetation on waterside slope.	
richard_s_20130304_701.JPG	



Levee Mile Report Line	48
Start Levee Mile	1.54
End Levee Mile	1.63
Location	Land Side
Category	
Item	Vegetation
Looking south at dense vegetation on landside shoulder and slope. (November 2011)	
richard_s_20130304_720.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	48
Start Levee Mile	1.54
End Levee Mile	1.63
Location	Land Side
Category	
Item	Vegetation
Looking south at dense vegetation on landside slope and toe spring 2012.	
richard_s_20130304_721.jpg	



Levee Mile Report Line	48
Start Levee Mile	1.54
End Levee Mile	1.63
Location	Land Side
Category	
Item	Vegetation
Looking southwest at vegetation on landside slope and toe. (Fall Inspection 2012)	
richard_s_20130304_722.JPG	



Levee Mile Report Line	49
Start Levee Mile	1.54
End Levee Mile	1.54
Location	Water Side
Category	
Item	Encroachments
Looking northeast at garbage on waterside slope.	
richard_s_20130304_702.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	51
Start Levee Mile	1.69
End Levee Mile	1.69
Location	Water Side
Category	
Item	Encroachments
Looking northeast at garbage on waterside slope. (May 2011)	
richard_s_20130304_723.jpg	



Levee Mile Report Line	51
Start Levee Mile	1.69
End Levee Mile	1.69
Location	Water Side
Category	
Item	Encroachments
Looking north at garbage and pruning pile on waterside shoulder. (November 2011)	
richard_s_20130304_724.jpg	



Levee Mile Report Line	52
Start Levee Mile	1.69
End Levee Mile	1.70
Location	Water Side
Category	
Item	Encroachments
Looking southeast at pruning piles on waterside shoulder & slope.	
richard_s_20130304_711.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.74	03/05/2013 03/05/2013	Richard Willoughby

Levee Mile Report Line	53
Start Levee Mile	1.71
End Levee Mile	1.72
Location	Water Side
Category	
Item	Trim / Thin Trees
Looking north (upstream) at dense trees on landside slope.	
richard_s_20130307_982.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---